
DBC-16H Key Warranty Instructions

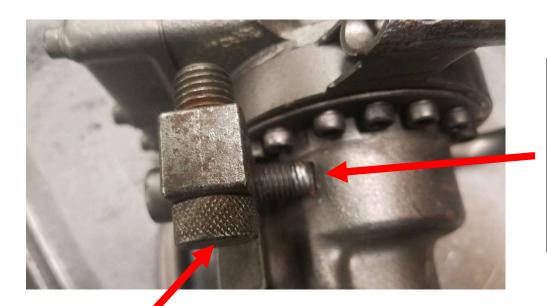

CRITICAL ISSUE #2

Cap bolt must be firmly tightened against the housing to help support the stopper stay.

(was loose and off the housing when the tool was received. This prevents proper support of the stopper stay and will cause failure NOT covered under warranty)

CRITICAL ISSUE #1

Stopper bolt must be adjusted out to ensure the rebar is perpendicular (right angle) to the bending roller.

(was firmly stuck in the stopper stay which is a clear indication that rebar has been bent improperly and not perpendicular to the bending rollers. This puts undue stress on the piston and the pinion and will cause tool failure NOT covered under warranty)